

## 9 January 2024

Ref: 10586/10169

Daracon Quarries Pty Ltd PO Box 299 WALLSEND NSW 2287

### RE: NOVEMBER 2023 ATTENDED NOISE MONITORING RESULTS – BUTTAI QUARRY

This letter report presents the results of attended noise monitoring conducted for the Buttai Quarry (BQ) on Wednesday 22<sup>nd</sup> of November, 2023. Noise monitoring was carried out in accordance with the conditions of the BQ Noise Management Plan (NMP) as shown in extract below.

#### 6.4 NOISE MANAGEMENT PLAN

# 6.4.1 Objectives

- · to ensure that quarry operations do not give rise to 'offensive noise';
- to minimise the impact of noise on surrounding residents;
- to meet the relevant noise criteria applicable to quarry operations as detailed in conditions of consent (under neutral conditions when measured within a radius of 30 metres):

an LA10 (15 minute) of 38dBA (daytime)

an LA10 (15 minute) of 32 dBA (night time)

noise of traffic associated with the quarry operations shall not exceed an Laeq (1 hour) of 50dBA when measured or computed at the façade of any dwelling.

Phone: (02) 4954 2276




# **NOISE MONITORING LOCATIONS**

Noise measurement locations for the attended noise survey are listed below and shown in the accompanying figure:

Location 1: Brooks, 45 Old Buttai Road

Location 2: Maddison (Buttai Barn), 160 Lings Road

Location 3: Bishop, 281 Lings Road

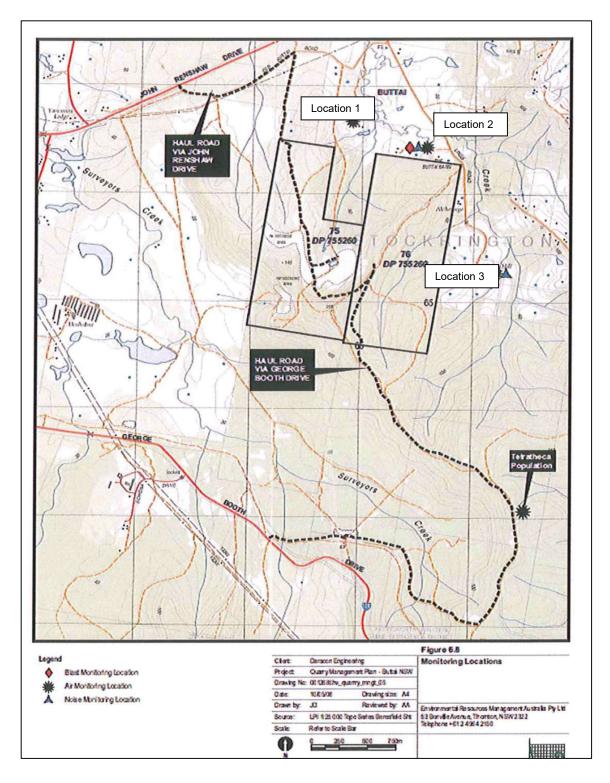



Doc. No: 10586-10169 January 2024



### **NOISE MEASUREMENTS**

Noise emission levels were measured with a Brüel & Kjær Type 2250 Precision Sound Analyser. This instrument has Type 1 characteristics as defined in AS1259-1982 "Sound Level Meters". Calibration of the instrument was confirmed with a Brüel & Kjær Type 4231 Sound Level Calibrator prior to and at the completion of measurements.

Meteorological data used in this report was obtained from a hand held weather station with measurements made at approximately 2m above ground level. The weather throughout the survey was mild with hazy skies. The winds were moderate from the southwest.

The following plant and equipment was working on the day that the monitoring was being undertaken;

- 1x impact crusher;
- 1x stacker making clay capping;
- 3x loaders;
- 2x 30t excavators;
- 1x watercart;
- 66 truck and dogs out the gate;

# **RESULTS**

The measured noise levels, over 1 second intervals, were analysed using Brüel & Kjær "Evaluator" software. The software enables the contributions of the quarry and other significant noise sources to the overall to be quantified. Noise levels were recorded for each of the L10, Leq (15 min), Lmax, L1, L90 and Lmin percentiles. As detailed in the NMP the noise criterion for BQ during the day is based on an L10 noise level.

The results shown in **Table 1**, below, represent the total 15 minute L10 noise level for all noise sources. Noise from BQ is shown in bold type. Levels for the other percentiles are not shown as they have no compliance criteria for comparison but are available on request.

Table 1				
Buttai Quarry Noise Monitoring Results – 22 November 2023				
		dB(A)	Wind speed/	
Location	Time	L <sub>10</sub>	direction	Identified Noise Sources
1	11:30 am	41	3.5 m/s SW	Birds & insects (40), traffic (34), BQ inaudible (<20)
2	11:50 am	38	2.5 m/s SW	Birds & insects (36), traffic (33), BQ inaudible (<20)
3	12:15 am	39	3.0 m/s SW	Birds & insects (39), traffic (26), BQ inaudible (<20)



Doc. No: 10586-10169 January 2024



The results shown in Table 1 show that, under the operational and atmospheric conditions at the time of monitoring, noise emissions from BQ were inaudible at all monitoring locations. The operation of BQ was, therefore, in compliance with the applicable noise conditions detailed in the NMP.

We trust this report fulfils your requirements at this time, however, should you require additional information or assistance please contact the undersigned on 4954 2276.

Yours faithfully,

**SPECTRUM ACOUSTICS PTY LIMITED** 

Neil Pennington MAIP, MAAS, MASA

B. Sc., B.Math. (Hons)
Principal / Director



Doc. No: 10586-10169 January 2024